AUG 29 1991

N.C. Cept. NRCB

Winston-Salem

Regional Office

P.O. Box \$86k18631 Greensboro, NC 27419 (919) 668-4821

August 28, 1991

Tom Salley NCDEHNR 8025 North Point Blvd. Suite 100 Winston-Salem, NC 27106

Re: Parkway Baptist Church 1411 Benjamin Parkway Greensboro, NC 27408 Guilford County

Dear Mr. Salley;

On August 12, 13, and 14, 1991 we removed 121.060 tons of contaminated from the above site. The soils were hauled to Lee Brick for disposal.

On June 3 and 4 we had removed two heating oil tanks from this site. One tank was 2000 gallons and the other was 6000 gallons. This work was reported to your office by letter on June 17. 98.16 tons of soil was removed from the 2000 gallon hole and the remaining 22.9 tons was removed from the 6000 gallon hole.

We used our hnu meter while digging to determine the verticle and horizontal extents of contamination. When we felt both holes were clean, we took soil samples as indicated on the site maps. The soil sample results and the chain of custody form are attached.

The soil samples taken on June 3 after we removed the 2000 gallon tank showed the contamination to be at the north end of the tank (at the fill pipe). Because of this, no soil was removed under the south end of this tank.

The soil samples taken on June 4 after we removed the 6000 gallon tank showed the contamination to be at the west end of the tank. Again, while cleaning up this hole, we only dug at this end of the tank.

If you have any questions about this site, please let me know.

Sincerely

Thad Chesson

cc: Mary Brewer Kelly Gage P.O. BOX 1027

SANFORD, NC 27330

(919) 774-4800

NC TOLL FREE 800-672-7559

FAX (919) 774-7557

Lee Brick & Tile Company, Inc., operating under the State of North Carolina Air Permit #3464R10 and the Contaminated Soil Disposal Permit # WQ0002988, hereby acknowledges the acceptance of 121.060of soil contaminated with fuel hydrocarbons and will handle the disposal of this soil in the prescribed manner as set forth by the Division of Environmental Management of the Department of Environment, Health, and Natural Resources, State of North Carolina, Raleigh, North Carolina.

COMPANY:	Piedmont Environmental Service					
	(Name) P. O. Box 18631					
	(Street Address)					
	Greensboro, N. C. 27419	_				
•	(City, State & ZIP Code)					
JOB LOCATION:	Parkway Baptist Church					
	(Name)					
	1411 Benjamin Parkway					
	(Street Address)					
	Greensboro, N. C. 27408					
h .	(City, State & ZIP Code)					
TRUCKING COMPANY:	Long Bros. of Summerfield, Inc.					
	(Name)					
	1024 E. Mountain St.					
	(Street Address)					
•	Kernersville, N. C. 27284					
	(City, State & ZIP Code)					

Date Received: 8-12-91 & 8-14-91

LEE BRICK & TILE COMPAN: INC.

President

(Position with e Brick & Tile Co.)

BRICK for the finest Building

for the finest Brick

and a second responsible to the first of the second free and the contribution of the

August 15, 1991

REPORT OF ANALYSIS

JOB #:

PES10812

CUSTOMER: Piedmont Environmental

ATTN: Thad Chesson

3

P. O. #:

Parkway Baptist

SAMPLE:

3757 2000 GAL HEATING DIL NORTH WALL

3758 2000 GAL HEATING DIL FLOOR

3759 2000 GAL HEATING DIL EAST WALL # 3760 2000 GAL HEATING DIL WEST WALL

RESULTS		3757	3758	3759	3760
Total Petroleum Hydrocarbons as Gasoline by EPA Method 5030	(ppm)	(10	(10	(10	(10
Total Petroleum Hydrocarbons by EPA Method 3550	(ppm)	√(10)	⟨1∅	(10	(10

Guilford/Laboratories, Inc.

August 26, 1991

REPORT OF ANALYSIS

JOB #:

PES10813

CUSTOMER: Piedmont Environmental

ATTN: Thad Chesson

. ,2

P.O.#:

Parkway Baptist

SAMPLE:

3845 6000 GAL HEATING DIL WEST WALL

3846 6000 GAL HEATING OIL WEST FLOOR

RESULTS	<u> 3845</u>	<u>3846</u>
Total Petroleum Hydrocarbons (ppm) as Gasoline by EPA Method 5030	(10)	⟨1∅
Total Petroleum Hydrocarbons (ppm) by EPA Method 3550	⟨1∅	(10

Guilford Laboratories, Inc.

Recieved by:	Relinguished by :	Recieved by:	Relinquished by :	Recieved by:	Relinquished by:	Racieved by:	Relinquished by:		Wo	PA	110 they coop occor	Sample Description	Sampler's Name: 12 Sampling Date: 1/12 Sampling Time: 10:4
						Mersten	2CL	7-3	MOG + WA 11	east NALL	Phon	ı	6 . 4 . 54 15/21 596
Date:/	Date://	Date://	Date:	Date:/	Date://	Date: 812191	Date: 8 //2/2/		٠,	" ""	S SAM	Matrix Container	Sampling Site:
Time: (p	Time (p/	Time:(p	Time: (p	Time : (p	Time: (p	Time 1/1: 22 (p 1/a)	Time 11:30 (p (a)			*	cooler	Preservation	Parmy Baptist
(p / a)	(8)	(p / a)	(p / a)	(p / a)	(p / a)		(a)				10H 3550 5600		S = Soil WW = Waste Water DW = Drink.Water GW = Ground Wate


Guilford Labs Phone :

919-854-2320

Relinquished by:	Relinquished by:	Relinquished by:	Relinquished by:	2	Sampling Date: 8/13/31 Sampling Date: 8/13/31 Sampling Time: 10:45 (p/a) Sample Description 6000 hooting oil westernd floor
Date:/ Time: (p / a)	Date://_ Time: (p / a)	Date:/ Time: (p / a) Date:/ Time: (p / a)	Date: 8/13/71 Time 2:45(0) a)		Sampling Site: Parkuray baptist WH = Waste Water DN = Drink. Water CN = Ground Water S = Soil N = Drink. Water CN = Ground Water O = Other


Guilford Labs Phore :

919-854-2320

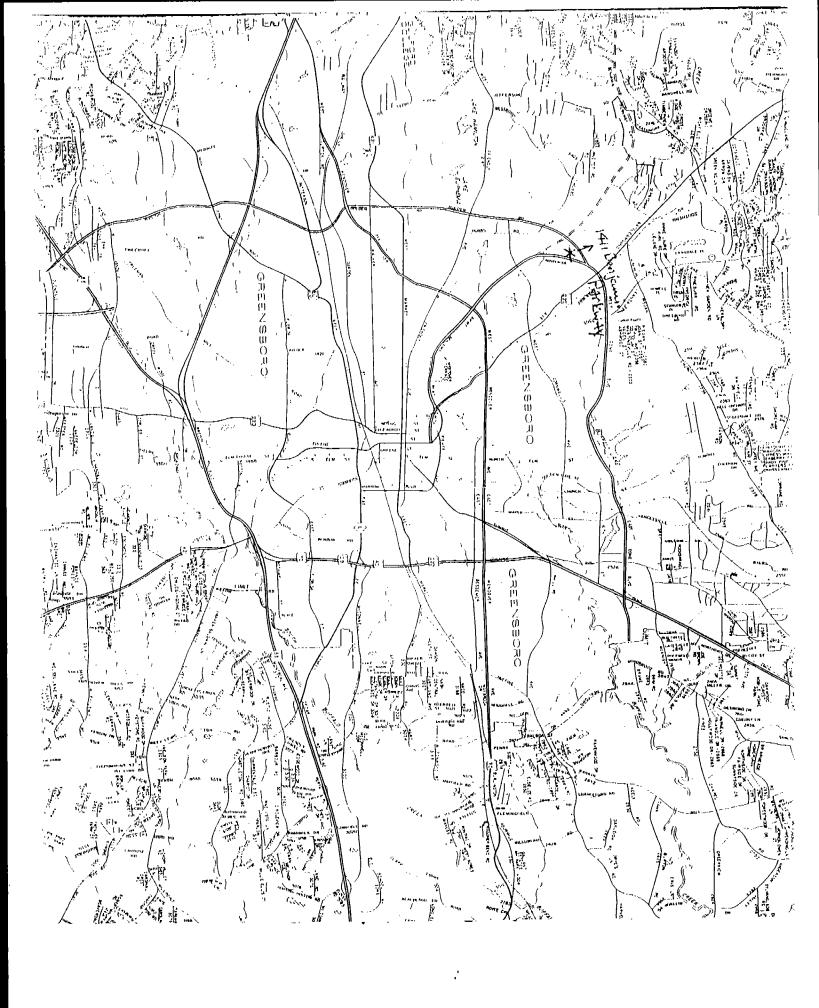

Serjamin Partway




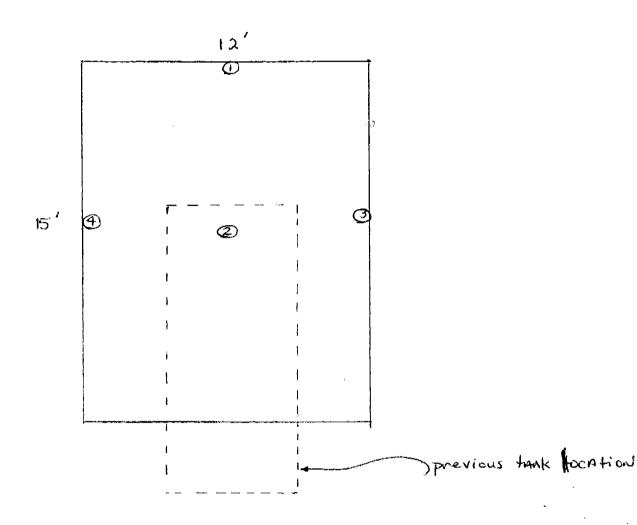

- 1 # 3757 North Wall at 10' depth
- 2 # 3758 Floor at 14' depth
- 3 # 3759 East wall at 10' depth
- # 3760 West wall at 10' depth

Z ←----

6000 gallow heating oil Sketch # 2

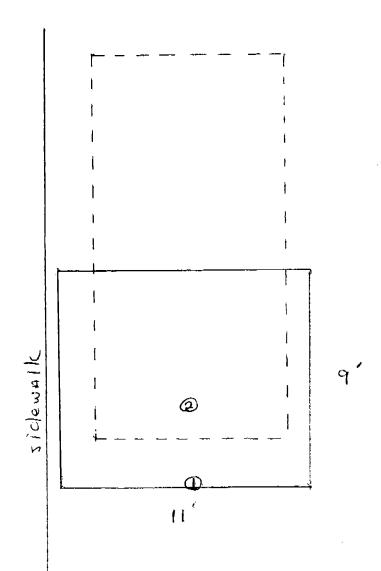

- (1) # 3845 West WALL at 9'
- @ # 3846 floor at \$3'

entrance